

## British Gliding Association Aircraft Inspection

Mandatory

Number:	Issue:
006/08/2000	1

Date: 19<sup>th</sup> August 2000

Subject: Vega Elevator Drive

Applicability: Slingsby T65 Vega Gliders

Accomplishment: By 30<sup>th</sup> September 2000 and Annually at C of A inspections. Also following ground loop or heavy landing.

Reason: Cracks found in elevator drive tongue.

Instructions: 1/ Remove tailplane and elevators

2/ Remove elevators

3/ Carry out close visual inspection of the elevator tongue "U" section using a magnifying glass at least 10x. for

cracks or disbonding. Pay particular attention in the area of the pivot bush

4/ Any damage found requires rectification before further flight.

5/ Refit tailplane assembly.

6/ Record compliance with this inspection in glider log book.

7/ Check embodiment of Slingsby Technical Instruction 104/T65 dated 14<sup>th</sup> February 1983.

8/ Report defects to BGA.

Approved By

Jim Hammerton, Chief Technical Officer