BGA accident/incident summaries

PILOT AIRCRAFT **Type** Olympia 2 Ref Damage Date, time Place Injury P1 hours Age 27/06/15, 14:20 Cotswold GC substantial 54 94 none 200 Hard landing during pilot's first flight on type. The glider was seen to be slow on the approach before descending from about 10ft agl and landing heavily, breaking the fuselage behind the wing trailing edge. The pilot reports that he rounded out, but didn't have time to close the airbrakes. substantial 27/06/15, 11:45 Bicester GC 95 JS1 68 none 4302 Landing in crop field after low-level aerotow launch failure. The glider pilot had asked for "maximum speed" from the Pawnee tug pilot before taking off with a fully ballasted glider into a light wind. After passing the arfield boundary the tug started to turn to the right away from a noise sensitive area, but the glider pilot reports having insufficient aileron authority to follow the tug. As the two aircraft diverged, the glider's left wing dropped and the pilot was just able to recover from the stall before landing in a crop field. Analysis of the trace suggests that the tug cleared the 50ft high boundary trees by about 40ft at an airspeed above the glider manufacturer's recommended minimum aerotow speed of 65 knots, but below the recommended turbulent speed of 70kts. The glider pilot reports an airspeed of 60kts and "some aileron authority" before reaching the trees. DR 400 24/06/15, 16:45 Lasham GS 96 22 not reported minor none Tow rope and aerotow rings struck parked car. The approach to the cross runway passed over boundary trees, trailers and parked cars and gliders. The tug's approach was flown too low to allow for the trailing aerotow rope, causing minor damage to a parked car. 30/05/15, 16:40 Lasham GS substantial 62 none Undercarriage collapsed on landing. During his final glide, the pilot realised that he would not reach the airfield and made a late field selection. He lowered the undercarriage, but then used the undercarriage handle rather than the airbrake. Realising, he lowered the wheel again, but failed to lock it down and the fuselage and a wing were damaged when the wheel retracted on landing. minor 27/06/15, 14:00 Black Mountains GC 69 none 1383 Undercarriage retraction during take-off caused minor damage. It is thought that a parachute strap may have caught on the undercarriage handle and lifted it out of its locking detent at the end of the previous flight. 03/06/15. 17:50 Southdown GC 99 K-21 minor none/none not reported Wingtip caught in crop during a field landing; the glider groundlooped leaving a crack in one wingtip. DG-808 substantial 03/07/15, 14:30 Midlem airfield 300 67 none Wingtip caught in grass on take-off. After visiting a farm strip, the pilot lined up for departure on the 25m wide grass runway. Just as the glider started to take off, one wingtip caught in the longer grass at the edge of the runway, turning the glider which then flew low over the long grass for 50m before landing in the grass and groundlooping, hitting a fence and hedge in the process. The fuselage broke, the canopy shattered, one wing was substantially damaged and the other had minor damage. 04/07/15, 16:00 Cotswold GC substantial 53 none 103 Glider hit airfield signs after landing. After touching down, the glider turned slightly out of wind and the port wing was damaged after hitting two signs on posts at the edge of the landing area. 05/07/15, 14:00 Bicester GC 9 K-21 substantial 30 103 none Field landing accident. The low-airtime pilot got lost while local soaring and landed heavily in a rough field. The fuselage snapped, the tailplane and nosewheel were damaged. 06/07/15. 18:15 Buckminster GC 55/13 K-13 destroyed none/minor 400 Crash landing at the end of a trial flight. As the glider was landing, one wing dropped and dragged on the ground, yawing the glider which then passed over a hedge before crashing nose down into the adjacent field. The air cadet P2 reported a twisted ankle. Duo Discus minor 09/06/15, 15:30 La Motte du Caire 68/62 none/none 1500 106 Wheel-up landing. 27/06/15, 14:10 Booker GC 40 substantial 380 107 Discus none Field landing in to a crop field. Preparing to land out at a gliding club, the pilot noticed another glider circling nearby and headed towards it. Unable to find lift, the pilot prepared to land in what appeared to be a stubble field, although he could see tractor wheelings. He made a couple of attempts to start the turbo on the downwind leg before concentrating on landing. On final approach, the pilot realised that the field contained mature, deep crop. He rounded out over the top of the crop, intending to touch down at the slowest possible speed. The glider fell through the crop and landed heavily, damaging the undercarriage. One wing was creased after being caught in the crop. 108 09/07/15, 13:30 none 759 ASW 20 minor Booker GC Wheel-up landing. Flying cross-country, the pilot was looking for lift near another gliding club. Getting low, he made a hurried approach before landing on the airfield with the wheel up, causing minor damage to the underside. The pilot recalls releasing from the aerotow in lift and while concentrating on thermalling he omitted to raise the undercarriage, subsequently raising the wheel on approach to land. ASW 24 11/07/15, 16:00 109 minor Cambridge GC 36 none Undershot approach. The pilot opened the airbrakes to maintain separation from another glider slightly above and ahead, but ended up landing in a crop field 20m short of the runway. A winglet was damaged in the ensuing groundloop.

110Discussubstantial11/07/15, 14:15Fenland GC75minor213Wheel-up landing. The pilot tried to lower the undercarriage before touching down, but landed heavily on the runway with the
wheel still retracted. The glider had substantial internal and external damage, as well as damage to the tailwheel and a wingtip. The
pilot suffered back pain.

BGA accident/incident summaries continued

AIRCRAFT PILOT Ref **Type** K-18 **Age** 71 Damage Date, time Place Injury P1 hours
 Interview
 Interview
 Interview

 112
 K-18
 substantial
 16/07/15, 14:55
 Stratford GC
 71
 none
 54

 Glider landed in trees. After getting low on base leg, the pilot was unable to reach the airfield flying into the 15-20kt wind.
 54
substantial 17/09/14.15:30 Dartmoor GC 1570 113 lantar 72 none Glider ran through pothole on landing run. The pilot chose to land slightly across the airfield to compensate for the gusting crosswinds. This approach took the glider across a track down the centre of the airfield and, after hitting the pothole, the glider was tipped on to its nose. The pilot could not see any damage and the glider was flown again on another day. A partly delaminated and loose spar pin bushing was later discovered in one wing root. 115 K-6 18/07/15, -Essex GC 79 not reported minor none Glider landed in crop field adjacent to the airfield. During the early stages of the winch launch, the glider's airbrakes came open and remained open for the rest of the flight. After releasing, the pilot noticed the high sink rate, but not that the airbrakes were open. The pilot returned to the airfield, but the cicuit flown did not adequately allow for the high sink rate and the glider landed in a crop field, damaging the underside of the nose in the process. Norfolk GC 54/none/none K-13 minor 18/07/15, pm not reported Airbrake bellcrank mounting bracket failed during flight. After a spin recovery demonstration, one airbrake was seen to be standing approx 1cm proud of the wing top surface. Fully opening and then closing the airbrakes cured this, but the airbrake was then sucked out again after flying at more than 60kts. 18/07/15, 11:30 Cambridge GC 59 Discus minor none not reported 117 Wheel retracted during winch ground run. Although the pilot released, the glider's momentum caused it to slide over a tarmac track, damaging the underside of the fuselage, the gear doors and the winch hook. substantial 19/07/15, 13:45 Devon & Somerset GC minor not reported 118 Junior Hard impact as glider failed to round out. The pilot reports that the glider attitude and wind noise were consistent with the usual approach speed, but that he didn't check the ASI. Late in the approach, there was no response to elevator inputs and the glider landed heavily nose first, damaging the cockpit and canopy. The pilot suffered back pain and a cut to his face. The pilot's report suggests that the glider may have stalled in the wind gradient. The elevator was found to be disconnected after the accident although, as the elevator was effective during the flight, the pilot suspects it may have become disconnected during the impact. 19/07/15, 17:00 Bidford GC Crop field landing damaged the tailplane. The pilot had selected a suitable landing field, but then elected to try to return to the airfield. Undershooting the final glide, the pilot made a late field selection and landed in crop near the airfield. Incidents Libelle 27/06/15,14:30 93 none _ Wheel-up landing on grass runway. 03/07/15, 17:00 100 Junior none After the take up slack signal was given, a passing pilot pointed out that the winch cable was attached to the aerotow hook. 104 K-13 none 06/07/15, 14:30 - - minor - Minor - The instructor was sitting in the rear seat with his right hand resting on the top of the fuselage side when the wind blew the canopy shut, trapping his hand between the canopy and the fuselage. 111 Puchacz minor 12/07/15, 18:00 While the batteries were being removed, the glider canopy blew shut leaving a large crack in the canopy. 28/05/15, 15:25 Olympia 463 none Airbrakes came open during a bungey launch. Unable to gain airspeed, let alone soar, the glider descended to a safe field landing. The pilot was without his usual back cushion and, although he shut the airbrakes at the start of the launch, he inadvertantly opened the airbrakes again after take-off. 12/07/15, 14:45 119 DG-505 none Glider took off on an aerotow with the airbrakes unlocked. While waiting for the tug the P2, on a familiarisation flight, opened and closed the airbrakes and verbally confimed they were locked to the ground crew before accepting the tow rope. The slow climb rate seemed normal while being towed in the lee of a hill and there were no signals from the tug, but as they passed through 1,000ft the instructor gave the lever another push and it moved into the locked position. 25/07/15, 14:00 121 Grob Acro none Winch cable fell across public road. The glider released the broken cable at 900ft and, as it drifted down under the parachute, the crosswind took it off the airfield. The runway in use was R26, the wind was 15-20kts from the NNW. 23/07/15, 17:00 122 none Wheel-up landing. After a long aerotow retrieve, the pilot spent 45 minutes local soaring before preparing to land. The undercarriage was mistakenly retracted during the pilot's pre-landing checks. In a recent S&G survey, you told us that you would like to see more in-depth coverage of accidents and incidents. Edward Lockhart is now providing a little extra detail, where available, in the listings on these pages. We would also like to publish (anonymously) your stories of particular flights that have taught you a valuable flying lesson. Please send

details to editor@sailplaneandgliding.co.uk or by post to the address on p3.