BGA accident/incident summaries

AIRCRAFT Ref Туре Damage P1 hours Date, time Place Injury Age substantial 03/06/16, 20:10 South Wales GC none Landing overrun into a stream. After touching down, the pilot realised there wasn't much room for the ground run. He released the spoiler handle to reach for the wheelbrake, but when the spring-loaded spoilers retracted the TMG ballooned and floated for a while. By the time it touched down again there was not enough room to stop and the TMG toppled down an embankment into the stream, breaking the propeller, shock loading the engine and damaging the cowling. There was also damage to the wing and wing/ fuselage mounting. DG-505 04/06/16, 14:00 Scottish GC not reported Undercarriage collapsed during landing ground run. It was discovered that a weld had failed between the torque tube and undercarriage assembly and that there had been a substantial crack in the weld for some time. 05/06/16, 18:00 Chiltern GC Hole in leading edge of wing. While visiting another airfield, the TMG taxiied to avoid some long grass next to the taxiway, but a wingtip struck an obscured runway marker. 05/06/16, 15:00 Oxford GC minor 59 Wing trailing edge damaged during landing. A landing area had been cut in the long grass adjacent to the launchpoint, but, despite using full airbrake, the glider landed long and rolled into the long grass, catching a wingtip and groundlooping. 07/06/16,18:45 Santa Cilia, Spain 2870 minor none Undercarriage collapsed on landing. 07/06/16, 14:20 Wyvern GC 45 K-21 minor none/none Winch launch take-off groundloop. As the glider accelerated during the ground run, one wing began to go down. The instructor released before the wing touched the ground, but the tip caught in the approx 18" long grass. The glider had enough energy to groundloop through at least one and a half turns, damaging an aileron in the process. 14/06/16, 16:10 Yorkshire GC none/none 3000 Wheel-up landing. The visiting instructor left the wheel down after launching and then raised it before landing. 19/06/16. 15:05 Lincolnshire GC 15 not reported The early solo pilot allowed the glider to drift to one side of the runway during a winch take-off and the wingtip brushed against the edge of the retrieve tractor. There was compression damage to the trailing edge of the wing. substantial 05/06/16, 16:00 Cranwell GC Windshield and cockpit shroud of the open cockpit glider detached during winch launch. The shroud struck the fin, partially separating it from the fuselage and damaging the rudder. The locking mechanism may not have been fully engaged before take-off. 24/06/16, 15:30 201 Heavy landing after descending through a strong wind gradient damaged undercarriage. 03/07/16, 13:25 Nene Valley GC none Undercarriage retracted during landing. The pilot had lowered the wheel as part of his pre-landing checks, but had not ensured that it was locked down. 02/06/16, 15:10 Duo Discus substantial none/none not reported Groundloop during field landing left a crack in the trailing edge of the wing root. 06/07/16, 15:00 Herefordshire GC substantial Heavy landing in a field. The pilot had selected a field before looking for lift under a nearby cloud. He then realised that he was lower than he thought and that his intended landing direction into the light wind was downhill. Returning to the field, the pilot had to fly a low turn round a tree to line up an uphill landing; as he levelled the wings the glider ran out of energy and landed heavily. The pilot suffered compression fractures to some vertebrae. **Incidents** Zugvogel 14/05/16, 10:30 Tailplane skin deformed. A car hit the tow arm of a trailer, rotating it until it hit the tail of a glider parked nearby. 07/05/16, 10:30

The instructor reports that on two occasions the student released the wheel brake and attempted to close the spoilers prior to take-off, but as the student was holding the rotating handle vertically it would catch on the instrument panel, preventing the spring

loaded lever from moving fully forward and holding the spoilers about half open.

BGA accident/incident summaries continued

AIRCRAFT					PILOT		
Ref	Type Libelle	Damage substantial	Date, time 05/06/16, 17:10	Place	Age	Injury	P1 hours
83 Libelle substantial 05/06/16, 17:10 Tow incident. While being towed behind a car, a wingtip caught in crop adjacent to the runway, yawing the glider and breaking the fuselage just aft of the wings.							
86 Tow in	ASG 29 cident, a wingtip	minor caught in a hedge.	05/06/16, 14:00	-	-	-	-
				– w, breaking the window a the tow car, damaging th			- impact broke
88 A stro	T-61 ng gust slammed	minor the canopy shut leav	30/05/16, 16:00 ring a crack arcing	- from hinge to hinge.	-	-	-
89	K-21	none	06/06/16, 18:00	_	_	_	_
Winch cable knocked over club member. After the cable retrieve vehicle brought the cables to the launchpoint, one cable was released and taken to the glider. The retrieve driver thought that the other cables had also been unhooked and set off round the back of the glider intending to return to the winch. In fact, one cable was still attached and was dragged up over the wing of the glider, knocking over a launchpoint helper. By the time the retrieve stopped, the cable was lying over the fuselage and tailplane. Fortunately, the helper was uninjured and the glider undamaged.							
90 The gli	DG-1000 der took off on a	none erotow with the tail o	06/06/16, 18:30 dolly still attached.	-	-	-	-
				_ ight. A workshop examina allowing the shaft to come			- nich was
95 DG-1000 minor 07/06/16, 16:00 As the glider was being towed, the tail dolly hinges sheared. The tail fell off the dolly and the rudder hit part of the towbar, leaving a hole in the rudder.							
99 Pre-Br	Astir onze pilot becam	none e lost while local soa	19/06/16, 13:50 ring and landed at	- another airfield.	-	-	-
pilot, c		poor acceleration, ab		- light and variable, some s light launch while the glic			
102 Airpro	ASW 20 x with a light airc	none raft while on aerotow	25/06/16, 16:00 /.	-	-	-	-
				– ailwheel came off the tow e, damaging an aileron.	- vbar supp	– ort, the towbar ther	- n detached
with a		ded up close to the u		- tained in a small box had ating pushrod. When the			
				- ched from both the glide	- r and the	- tug. Investigation la	- ter found a

In an *S&G* survey, you told us that you would like to see more in-depth coverage of accidents and incidents. Edward Lockhart is now providing a little extra detail, where available, in the listings on these pages. We would also like to publish (anonymously) your stories of particular flights that have taught you a valuable flying lesson. Please send details to *editor@sailplaneandgliding.co.uk* or by post to the address on p3.